




Right-Angle Shapes, MIL style


Helashrink 1100 Series, with rib

Features and benefits

- Used in conjunction with a circular grooved adaptor for strain relief

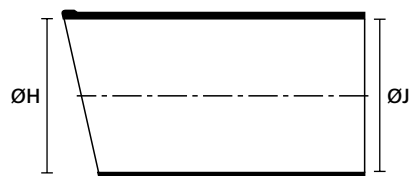

a: Expanded form (supplied)

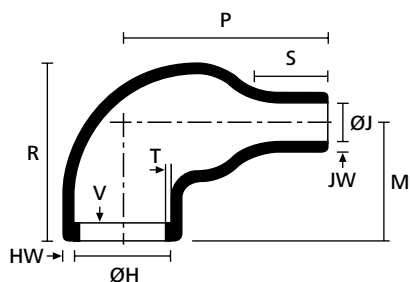

b: Fully recovered form (after heating)



1108-4 supplied / fully recovered.

TYPE	ØH min. a	ØH max. b	ØJ min. a	ØJ max. b	P ± 10 %	R ± 10 %	HW ± 20 %	JW ± 30 %	V max.	T ± 20 %	M nom.	S nom.	Article-No.
1108-4-G	16.5	7.9	16.5	3.8	17.3	20.1	1.0	1.6	3.3	1.0	15.2	5.1	411-08480


All dimensions in mm. Subject to technical changes.

Right-Angle Shapes


Helashrink 1100 Series, without rib

Features and benefits

- Strain relief for connector cable
- Easy re-entry for repair when combined with hot melt adhesive

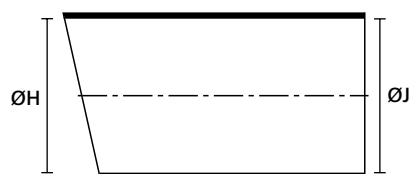

a: Expanded form (supplied)

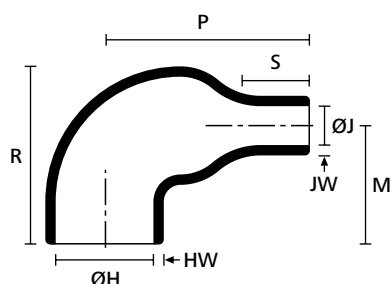

b: Fully recovered form (after heating)



1108-1 supplied / fully recovered.

TYPE	ØH min. a	ØH max. b	ØJ min. a	ØJ max. b	P ± 10 %	R ± 10 %	HW ± 20 %	JW ± 30 %	M nom.	S nom.	Article-No.
1108-1-G	16.5	7.9	16.5	2.5	18.3	20.1	1.0	1.6	15.2	5.1	411-08180

All dimensions in mm. Subject to technical changes.